

TECHNICAL BULLETIN

Air Control System Enhancement

SUBJECT: Part No. R-013462 and Service Kit
No. R-013282

LIT NO: TB-H761

DATE: October 2014

REVISION: A

INTRODUCTION

NEW FILTER ENHANCEMENT As of August 2014, Specialty Products–Hendrickson Auxiliary Axle Systems introduced a **NEW** air control system filter enhancement (Part Number R-013462) for use on new production vehicles equipped with Hendrickson auxiliary axle air control systems. This enhancement replaces the previous air control system and is intended to help further extend the life of air control systems by filtering contaminants that may enter the air system and cause wear on the seals and other components.

In addition, a NEW Air Control Filter System Service Kit (Number R-013282), see Figure 1, is available in the aftermarket to install on existing compatible Hendrickson auxiliary axle air control systems, refer to Table 1 on page 2. Likewise the filter (Part Number R-013462) itself, see Figure 2, is also available in the aftermarket for component replacement.

Contact Hendrickson Specialty Products – Auxiliary Axle Systems at 1.800.660.2829 for assistance with the distribution of or questions regarding Kit No. R-013282 or Part No. R-013462. Refer to Hendrickson Literature Nos. H723, H719 and H740 for more information on the proper installation, operation, and service of Hendrickson auxiliary axle air control systems.

HENDRICKSON RECOMMENDED MAINTENANCE INTERVAL

- Every six months, remove filter and visually inspect the air control filter (Part No. R-013462) for contaminants and replace as necessary to help ensure efficient operation. Another possible indication that filter component replacement may be necessary is when a notable difference in lift axle deployment/retraction has occurred, such as a decrease in the speed of deployment or retraction.

FIGURE 1




FIGURE 2



TABLE 1

Hendrickson Air Control Systems compatible with NEW filter Service Kit R-013282

| PART NUMBER | DESCRIPTION |
|-------------|--|
| HAC-ACO | Reverse Caster Inside Contained In Box |
| HAC-ASI | Reverse Caster Inside |
| HAC-ASO | Revers Caster Outside Contained In Box |
| HAC-MCA | Default Lift Outside |
| HAC-MSO | Maryland Spec Outside |
| HAC-NSI | Non-steer Inside |
| HAC-SSI | Standard lift in Reverse Inside |
| HAC-UCO | Universal Steer or Non-steer Outside |
| HAC-USO | Universal Steer or Non-steer Outside Box |

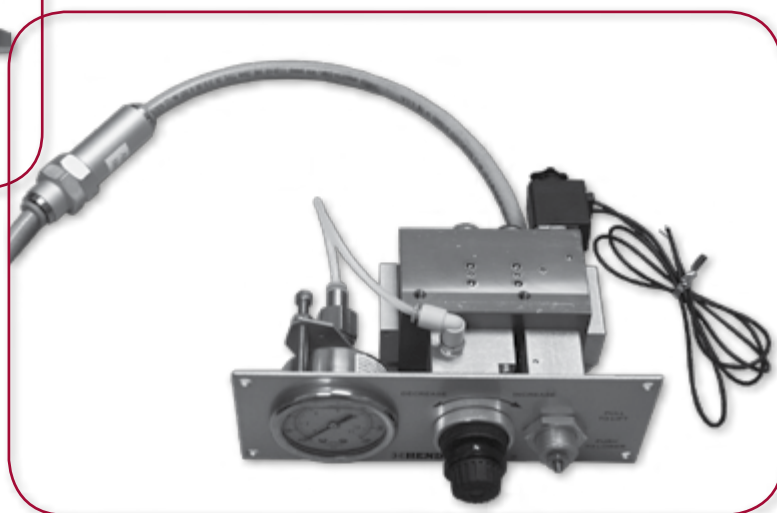

Refer any questions on this publication to Hendrickson Auxiliary Axle Systems Tech Services:



Toll-free U.S. and Canada
1.800.660.2829
Outside U.S. and Canada
1.740.929.5600



Parts Identification
LiftAxle@hendrickson-intl.com
Technical Support
LiftAxleTech@hendrickson-intl.com



1.740.929.5601



Additional Hendrickson
Product Information
www.hendrickson-intl.com

www.hendrickson-intl.com



Specialty Products - Auxiliary Axle Systems
277 North High Street
Hebron, OH 43025-8008 USA
1.800.660.2829 (Toll-free U.S. and Canada)
1.740.929.5600 (Outside U.S. and Canada)
Fax 1.740.929.5601

Hendrickson Canada
250 Chrysler Drive, Unit #3
Brampton, ON L6S 6B6 Canada
905.789.1030
Fax 905.789.1033